

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch

690 Walnut Ave.St. 150

Vallejo, CA 94592-1133

(707) 649-5453

(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-007653**Date Inspected:** 30-Jun-2009**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Wu Zhi Cheng**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG Segments**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Dan Hernandez was present during the times noted above to observe the fit up, welding and related activities associated with the fabrication of the San Francisco Oakland Bay Self Anchored Suspension Bridge at Zhenhua Port Machinery Company (ZPMC) facility on Changxing Island.

OBG Trial Assembly Yard

Segment 4BE

This QA Inspector observed Shielded Metal Arc Welding (SMAW) in progress of a Complete Joint Penetration (CJP) weld joint. The Weld joint is designated as OBE4-001. The welder is identified as #676171 and was observed welding in the 4G (overhead) position using approved Welding Procedure Specification WPS-B-P-2114-B-U2-FCM-1.

This QA Inspector observed Shielded Metal Arc Welding (SMAW) in progress of a Complete Joint Penetration (CJP) weld joint. The Weld joint is designated as SEG020A-031. The welder is identified as #068917 and was observed welding in the 4G (overhead) position using approved Welding Procedure Specification WPS-B-P-2114-B-U2-FCM-1.

Segment 1BW


WELDING INSPECTION REPORT

(Continued Page 2 of 2)

This QA Inspector observed the Counter Weight (CW) Connection plate at weld joint OBW1A-013 was distorted during welding of the CJP joint at the tapered end. The connection plate is distorted for approximately 200 mm in length and 12mm offset from face of the Deck Plate and CW connection plate.

ZPMC Quality Control (QC) Inspector is identified as Zhang Hai Tao. QA Inspector observed QC Inspectors verify welding parameters. The welding variables recorded by QC appeared to comply with the Applicable WPS.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

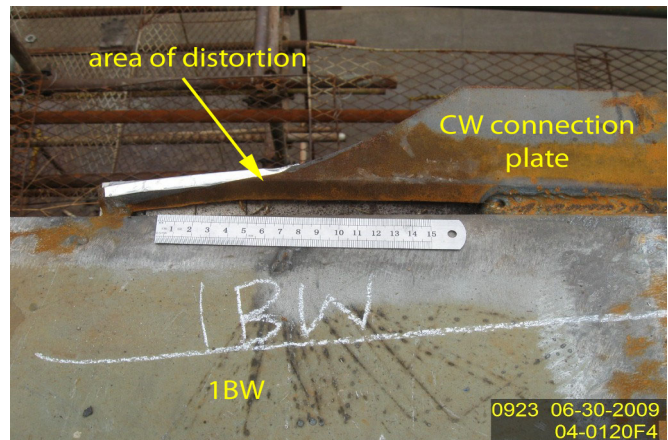

Summary of Conversations:

No relevant conversations.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang, 150-0042-2372 , who represents the Office of Structural Materials for your project.

Inspected By: Hernandez,Dan

Quality Assurance Inspector

Reviewed By: Carreon,Albert

QA Reviewer